


KERR HALL

BLDG # 0180

11-2018

Exterior Gross Area
37610

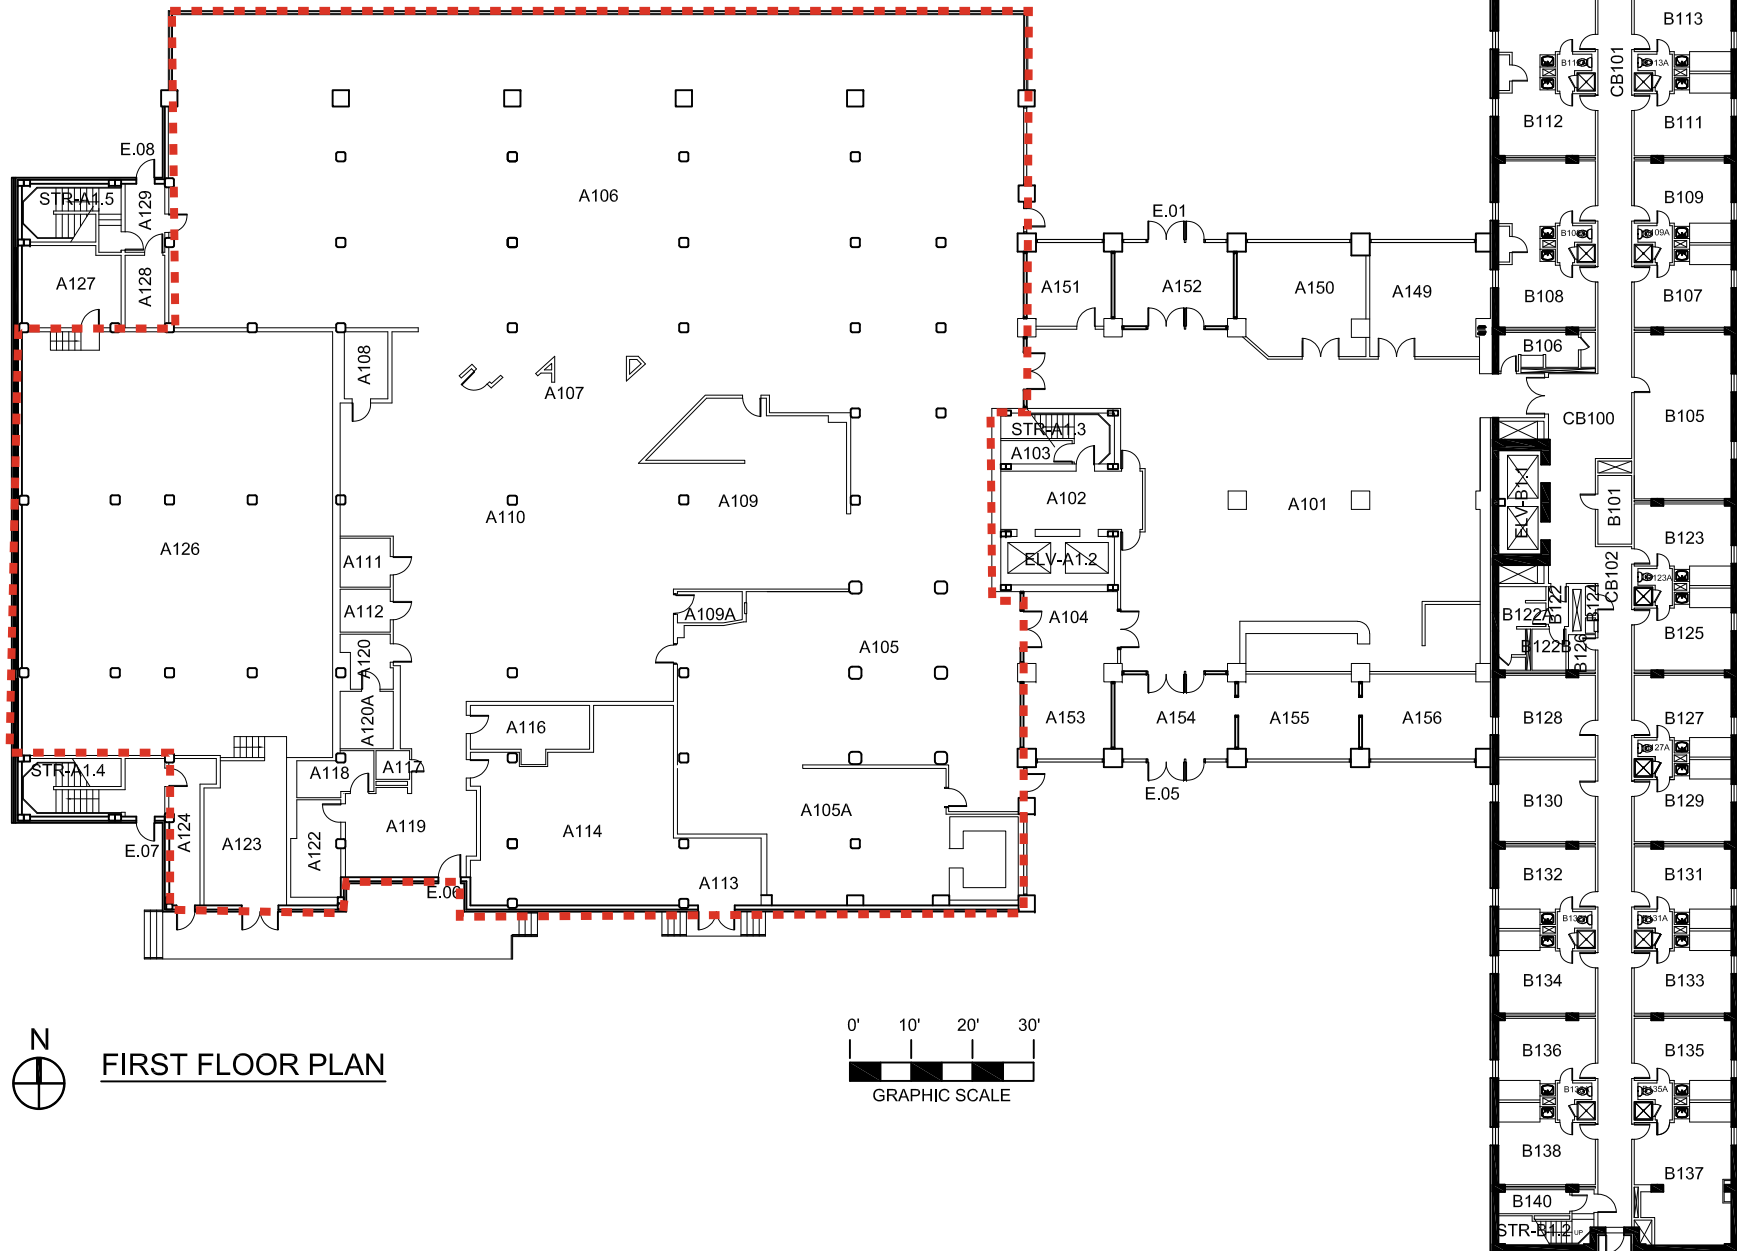

FIRST FLOOR PLAN

Kerr Hall ASBESTOS DETECTED

Room #	Sample #	Description of Sample	Asbestos Content	Date Taken
A105	220682	TSI Hard Elbow	5% AMO, 2% CHRY	10/4/2022
A105	220677	Black Mastic on Pipes	5% CHRY	10/4/2022
A105	G012K09	1'x1' Green ceramic FT plus	3% chrys - mastic only	12/13/2012
A105	G012K08	1'x1' Green ceramic FT plus	3% chrys - mastic only	12/13/2012
A105	G012K07	1'x1' Green ceramic FT plus	3% chrys - mastic only	12/13/2012
A105A	220683	TSI Hard Elbow	5% CHRY	10/4/2022
A105A	220678	Black Mastic on Pipes	5% CHRY	10/4/2022
A106	41	Chill water fit insulation	2% chrys	1999
A106	38	Dom. Hot water fit insulation	2% chrys - black mastic	1999
A106	220684	TSI Hard Elbow	5% CHRY	10/4/2022
A106	39	Dom. Hot water fit insulation	2% chrys - black mastic	1999

Kerr Hall NONE DETECTED

Room#	Sample	Description of Sample	Asbestos Content (numbers in %)	Date Taken
A105	141769	CMU / mortar	none detected	9/25/2014
A105	141770	CMU / mortar	none detected	9/25/2014
A105	141771	CMU / mortar	none detected	9/25/2014
A105	141775	Wall plaster	none detected	9/25/2014
A105	141776	Wall plaster	none detected	9/25/2014

Kerr Hall NONE DETECTED

Room#	Sample	Description of Sample	Asbestos Content (numbers in %)	Date Taken
A105	141777	Wall plaster	none detected	9/25/2014
A105	141778	Wall system-drywall-flat	none detected	9/25/2014
A105	141779	Wall system-drywall-flat	none detected	9/25/2014
A105	141780	Wall system-drywall-flat	none detected	9/25/2014
A105	220681	Black Mastic on Pipes	ND	10/4/2022
A105	220859	Plaster W/ Rough Texture	ND	10/31/2022
A105	220862	DWJC	ND	10/31/2022
A105	220863	DWJC	ND	10/31/2022
A105	220864	DWJC	ND	10/31/2022
A105	G012K07	Wall system-drywall-flat	nd	12/13/2012
A105	G012K08	Wall system-drywall-flat	nd	12/13/2012
A105	G012K09	Wall system-drywall-flat	nd	12/13/2012
A105A	220868	1" CWT W/ Grout	ND	10/31/2022
A105A	220869	1" CWT W/ Grout	ND	10/31/2022
A105A	220870	1" CWT W/ Grout	ND	10/31/2022
A106	150747	Faux wood VFT w/ mastic	nd	5/4/2015
A106	150748	Faux wood VFT w/ mastic	nd	5/4/2015
A106	150749	Faux wood VFT w/ mastic	nd	5/4/2015
A106	150750	2'x2' susp ceiling tile - dots	nd	5/4/2015
A106	150751	2'x2' susp ceiling tile - dots	nd	5/4/2015

Kerr Hall NONE DETECTED

Room#	Sample	Description of Sample	Asbestos Content (numbers in %)	Date Taken
A106	150752	2'x2' susp ceiling tile - dots	nd	5/4/2015
A106	150753	Wall system-drywall-sand	nd	5/4/2015
A106	150754	Wall system-drywall-sand	nd	5/4/2015
A106	150755	Wall system-drywall-sand	nd	5/4/2015
A106	220679	Black Mastic on Pipes	ND	10/4/2022
A106	220680	Black Mastic on Pipes	ND	10/4/2022
A106	220860	Plaster W/ Rough Texture	ND	10/31/2022
A106	220861	Plaster W/ Rough Texture	ND	10/31/2022
A106	2300329	Texture on Concrete	ND	5/22/2023
A106	2300330	Texture on Concrete	ND	5/22/2023
A106	2300331	Texture on Concrete	ND	5/22/2023
A106	2300332	DWJC W/ Rough Texture	ND	5/22/2023
A106	2300333	DWJC W/ Rough Texture	ND	5/22/2023
A106	2300334	DWJC W/ Rough Texture	ND	5/22/2023
A106	2300335	Glue Adhesive	ND	5/22/2023
A106	2300336	Glue Adhesive	ND	5/22/2023
A106	2300337	Glue Adhesive	ND	5/22/2023
A106	2300338	Flooring Materials	ND	5/22/2023
A106	2300339	Flooring Materials	ND	5/22/2023
A106	2300340	Flooring Materials	ND	5/22/2023

Kerr Hall NONE DETECTED

Room#	Sample	Description of Sample	Asbestos Content (numbers in %)	Date Taken
A106	40	Chilled water fittings insulation	none detected	1999
A107	G012K10	Wall system-drywall-flat	nd	12/13/2012
A107	G012K11	Wall system-drywall-flat	nd	12/13/2012
A109A	220851	DWJC W/ Rough Texture	ND	10/31/2022
A109A	220852	DWJC W/ Rough Texture	ND	10/31/2022
A109A	220853	DWJC W/ Rough Texture	ND	10/31/2022
A109A	220854	CMU W/ Filler	ND	10/31/2022
A110	141772	Mortar only	none detected	9/25/2014
A110	141773	Mortar only	none detected	9/25/2014
A110	141774	Mortar only	none detected	9/25/2014
A110	220685	1"x1" CFT W/ Grout & Glue	ND	10/6/2022
A110	220686	1"x1" CFT W/ Grout & Glue	ND	10/6/2022
A110	220687	1"x1" CFT W/ Grout & Glue	ND	10/6/2022
A110	220688	6"x6" CFT W/ Grout	ND	10/6/2022
A110	220689	6"x6" CFT W/ Grout	ND	10/6/2022
A110	220691	6"x6" CFT W/ Grout	ND	10/6/2022
A110	220865	4" CWT W/ Grout	ND	10/31/2022
A110	220866	4" CWT W/ Grout	ND	10/31/2022
A110	220867	4" CWT W/ Grout	ND	10/31/2022

Kerr Hall NONE DETECTED

Room#	Sample	Description of Sample	Asbestos Content (numbers in %)	Date Taken
A110	G013542	1'x1'Green ceramic tile/grout/thinset	nd-condomment isle	04/15/2013
A110	G013543	1'x1'Green ceramic tile/grout/thinset	nd-main course	04/15/2013
A110	G013544	1'x1'Green ceramic tile/grout/thinset	nd-main course	04/15/2013
A114	220855	CMU W/ Filler	ND	10/31/2022
A114	220856	CMU W/ Filler	ND	10/31/2022
A114	220857	Plaster W/ Rough Texture	ND	10/31/2022
A114	220871	Glue Adhesive	ND	10/31/2022
A114	220872	Glue Adhesive	ND	10/31/2022
A114	220873	Glue Adhesive	ND	10/31/2022
A116	220858	Plaster W/ Rough Texture	ND	10/31/2022